



ELECTRONICS

TECHNICAL BULLETIN

Date: December 7, 2000

NO.: 2000-21

TITLE: Speed Dial Flash Issue Solution

Please be informed that in the software versions listed below, programming a flash digit within a speed dial bin string, will not function properly. Upon dialing the speed dial string, the phone system will repeat the flash and not complete the dialing string.

- Compact: V2.4, 99.10.06
- DCS 50si: V1.2, 00.03.06
- DCS: V4.3, 00.03.06

A work around for this problem would be to use the Chain Dialing feature as follows : Activate a speed dial bin then press the flash key then activate another speed dial bin.

This issue will be corrected in the next version of software release, for each product

If you have any questions about this or any other Technical bulletins please contact Technical support by phone 1800 737 7008 or by email techsupportmiami@sta.samsung.com.